

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** All CDP/CDP-C

**No.** 286R1

**Subject:** Will Not Play Disc / Skips After Optical Block Replacement

**Date:** November 24, 1992

This bulletin supersedes Hi-Fi Service Bulletin No.286



**Symptom:**  
(12)

Unit will not read TOC or unit will skip after optical block has been replaced.

**Solution:**


Focus Bias is out of adjustment. Adjust focus bias pot on optical block KSS-240A as follows:

1. Use a YEDS-18 disc.
2. Adjust the focus bias pot for the clearest eye pattern.

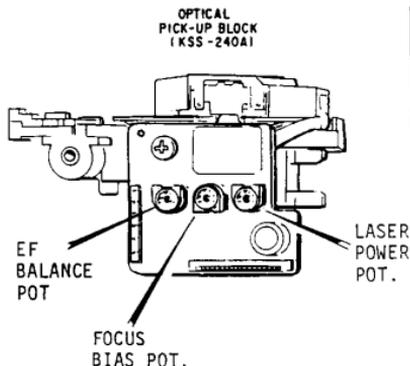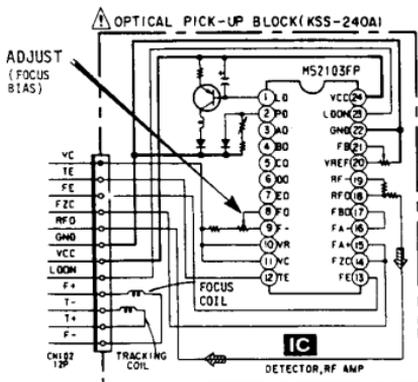

RF signal waveform

 VOLT/DIV 200mV  
TIME/DIV 500ns



Clear RF signal waveform means that the shape "◇" can be clearly distinguished at the center of the waveform.

